#6307060 (1)

9-3-1963 set C/M in place of pipe corner.
8-21-73 corner removed for sewer & airport
1/4 Corner West 1/4 of Marion 106-13.
11-28-73 reset C/M again no add. R.P.s.
East 1/4 of 12 Rock 106-14.


9-18 74 Hunter found stake set in previous survey at fence corner ?
-16 South found stake set previous survey M & L 19, 93 1/2

pipe in place at fence corner ~~Castillos land~~ for many years.
9-1963 set C/M in place of pipe.
- corner lies next to corner post of fence ~~north~~ east and south
no fence ~~south~~ north or west.

No Ties. Close N W Cor post.

over.

8-21-73. sewer construction to airport running on section line - removed C/M. set hub temp cor. set 1/2" rod 100 feet east then 107.35 farther to 1/2" rod on transit line this corner tricky to locate.

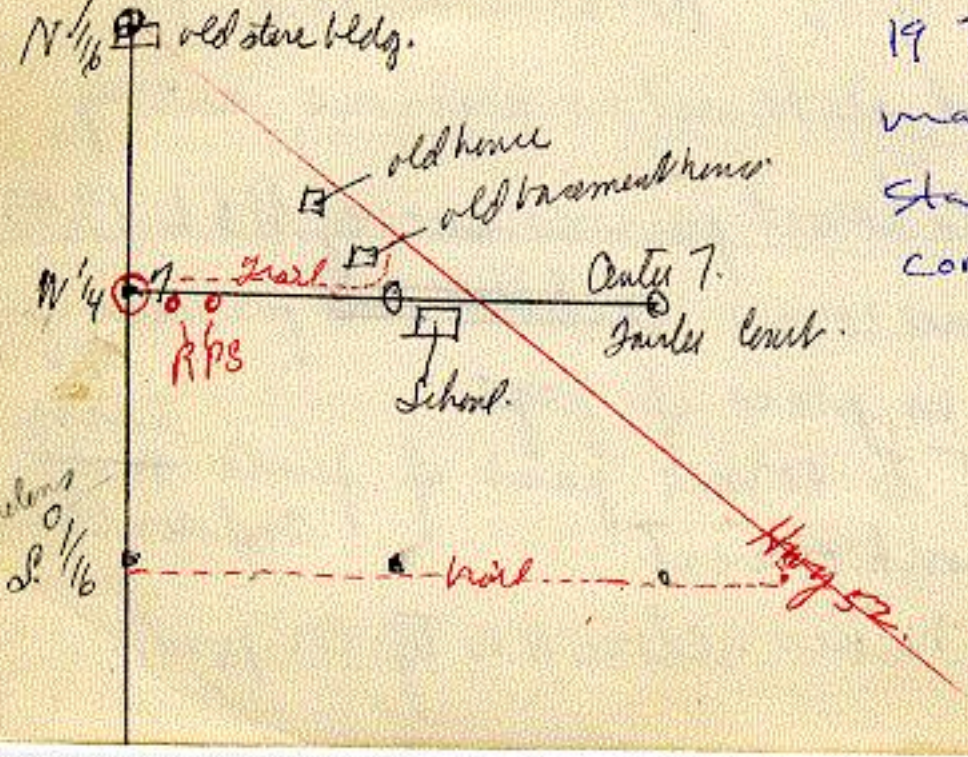

19? MHD ROW map shows wooden stake at fence corner

#630706 (2)

1/4 Corner | West 1/4 7 | Marion | 106-13
East 1/4 12 | Rochester | 106-14

June, 1856 Thos. Hunter Pg. 10 No. 16 shows 1/4 Post.
1/16 North 19.93 1/2 chs. M&L to Section Corner
Meas. East 38.73 to Center Section.

Govt Notes, Wm Jones 1853
40.00 Set quarter stone, post
Bx Oak 14 S 65° E 55 lks
" " 15 N 25° W 170 " "

12/1/88 DUG DOWN 2' TO BROKE C.I.M. WITH A FIBERGLASS POST AND ONE OF OUR Co. Surveyor Post which had been driven below the surface OF The lawn the bent T-Bar. we found at the surface didn't quite match the C.I.M.

OVER ↓

1/4 COR. W 7 MARION
E 12 ROCH

CONT. AND HAVING FOUND TWO PINS AT THE BLOCK CORNER NORTH WE TOOK THE C.I.M. TO BE CORRECT WE SET A 20" C.I.M 4" BELOW THE SURFACE.

R.P.'S METAL DISC IN P.P. W.N.W. 57.74
TOP OF FIRE HYDRANT N.E. 79.00
BACK OF SIDE WALK NORTH 10.26'

CORNER NOW FALLS IN THE S.E. CORNER OF THE INTERSECTION OF 17TH ST & 19TH AVE. S.E.

7/10/45 C.A. Armstrong found wedge shaped limestone (bk B, pg 566) at north side of fence used corner and 1/16th north to set NE cor of sec 12, 1/4th cor north found 1/2" iron pipe 1317.8' north of 1/4 corner.