/ MCd B - Set 5/8" pipe from 1985 Ties — after road was graded
5/8" rod 1973 — Took New Ties 8-1985 RwB (1)

section corner. 9-10-15-16 Cascade. 107-14
#741005
4-1870 R Perry P108 no 147. Sec 9 & 10 M.C. Clark
set a stone by testimony statement of oldest settlers.
-16 N set a stone M & L 19.70 (1300.3 to 1/4 9-10
a stone set M & L
- Meas east to a point found "but did not retain it."
40.03 (2642.0 then 40.03 to stone set by testimony
as 10-11-14-15 by statements of 4 settlers including
Mr Boardman, no proof this corner is any where near line.
6-1874 Hunter. P 256 no 256. Sec 10 Phil Boardman.
"found as set for Sec. corner in survey no 147.
Meas east 39.67 (2618.22 To small stake set from south. (1985)

5-1911 Chas Larson P 166 B. Secs 9 (E½) 10 (W½)
plat and desc. of corners typical of Chas Larson.
Seline corner # 4 to be 9-10-15-16.
"limestone by R Perry. 3 feet below surface" —
No mons except 40 chains both east & west.

11-1916 J Kerr. P 252 B J Bandell and Others Secs 3-10.
Quote "started random line no 3 at ¼ 9-10, ran south
found 1/16 corner at 1297. (not described at all)
reset stone at S.E. of sec. 9. and took B tree (long gone)
(no desc. of this corner stone or how & why reset).
(or why 1303 S of 1/16 and 1297 N of 1/16.)


See Kerr BK 8 P. 68

See card #2.

Card # 2. 9-10-15-16 Cascade. 107-14 (2)
#741005

6-1935 J Kerr. Book 10 page 9. Robt Parson survey. Sec 9.
found "5 corners" corner. - needed. SE corner 9. dug
for some time. went for details of 1916 survey at courthouse.
meanwhile help had found "quite the hole where the corner had
been placed by Robt Perry. but the stone had been removed.
however. the broken crockery & glass was in the bottom of the
hole. and measurements from the corners north proved it to be
correct. I then ran line west ½ mile and set stakes 33'
south of same (line) at such places as Mr Parsons wanted them
Page 8. West line Sec 10. □ 1303 stone found 1297 • stone found 1300 • stone set 1300 • stone set.
No Sec & stones or ¼ lines
direct or straight.
south line Sec 10. □ 1319.5 pipe ○ 1319.5 • stone 1319.5 • stone 1319.5 • stone

after 1935 Corner lost County Hwy dept assumed point equal from 1/4 corners East and west to the same trees as from that 1/4 corner. To section corner beyond.

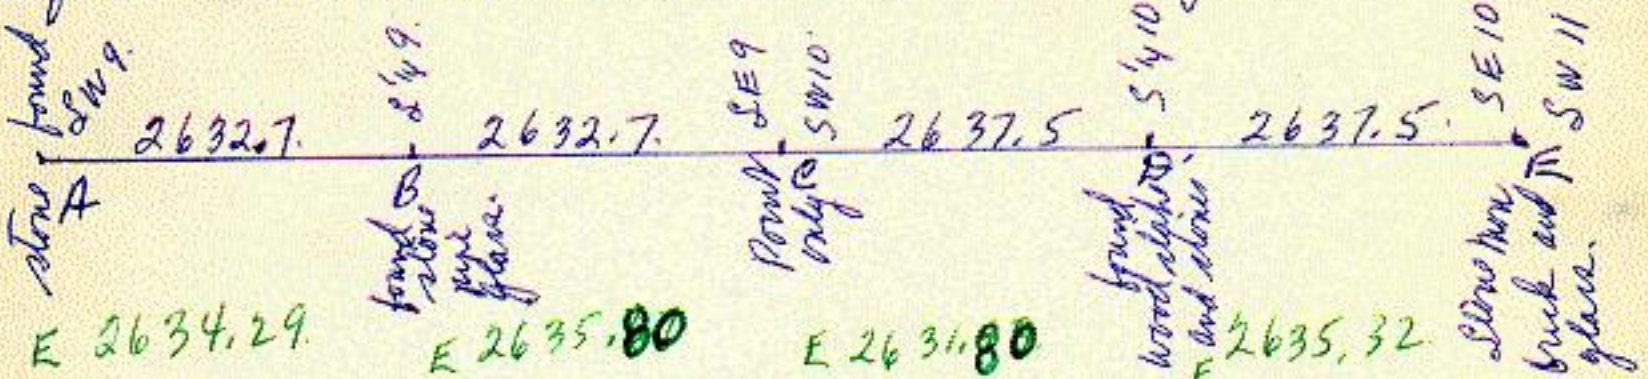

Hal 2 Miles 0. 10540.4 E 10537.21 diff 3.2.

C H D. 7-15-1935.

SW9. stone mon with old rotted stake on E side 4' deep

S 1/4 9. found iron pipe in top of stone with broken glass around it.

SE 9, SW 10 - used assumed point as above made.

S 1/4 10. found old rotted stake. in center pile of rocks

SE 10, SW 11 - found stone mon broken glass & bricks.

line from last E over D fell 1.0' north of line from west Mon B. Mon map .5'

Card # 3. 9-10-15-16. Cascade. 107-14 (3)
1-2-1973. final on PK set as corner until proven
wrong enough to change. #741005
12-28-1972. dug in 14" post for Perrys 1/16 stone north.
found long thin limestone 3" x 4" x 18" ± with chisel point
type top. 7' west of lower fence wire of N-S fence.
2.2' South of " " " " E-W "
Offset 125' west at 1/16 stone and C/M at 1/4 9-10
found corrected mean betw. C/M & 1/16 stone 1299.9 R Perry 1300.3
- set large PK at double this mean and corrected crack line
which fell slightly S of new blacktop mat and 8' E of fence N-S.
both 1/4 9-10 and 1/16 stone about same. 9' west main line fences
at those points. No RPS will check carefully N of 1/4 9-10
for 1/16 stones tich Perry 1870 and J Kerr 1916 which may be many feet diff.
ord

1-3-1973 accepting all points from. ℄W 9 to ℄E 10 as final until changed if changed meas electronic. See Card 2.
line from C/M at 10-11-14-15 (now believed correct without doubt) over 1/4 10-15 reset small nail from 3 to RPS
fell 2.63 North of decribed large PK. closer to ℄.
if elec meas west made equal as Chas Larson and
Perry claims PK would go. 2635.67 - 2634.29 or 1.38 west.
May not change N-S until work done on Perry line betw 9-10.
3-30-73. after re-running line, checking 125' offsets on 3-28
drive 5/8"x12" rod as final corner in black top, removed PK.
92.5 WNW to center number plate on S side PP 39609
22.93 Near due N to extreme NE corner new conc hdw
5/8"x12" rod moved .06' N. and .13' E. of former P.K. nail Location

Cascade Section corner 9-10-15-16 14
Gov't Meander M. Kennick 1954 #741005
80.00 Set post for corner to section 9-10-15-16
in mound with trench, pits, charred
stake & Orange Orange circles at
each angle

8-7-1985 RWB - Co. Surveyor
found 5/8" iron rod in Blacktop 55th St. N.W. just
before regrading on 55th St. N.W.
Took new R.P.'s - Co. Surv. disc in RP. (No No.) N. - 76.24
C.S. disc in P.P. (No No.) W.SW. - 90.90
C.S. disc in PP # 39609 - N.W. 92.55
Top Center of Hydrant. N.W. - 95.13

1/16 Cor - East. See over this card.
did not check 2" pipe for line or dist. this date. RWB.

8-22-1985 Co. Surveyor RWB — At 1/16 Corner (±) East, found a 2" iron pipe (could be Kerr's set in 1916 or 1933) This pipe found by City of Rock Engr. Crew staking for regrading on 55th St W.
Top of pipe ± 8" deep from Blacktop surface.
Used Rock. S+G dozer and dug ± 1 foot deep on each side of pipe but did not find anything else, dug 10' N. & S. of pipe and 5'E To 3' West. Evidence of old road just above Yellow soil indicating road in Cut. Road Bank N. is ± 6' heighor than road surface. Left pipe in place. Pipe is ± 4' West of steel post fence running North.
Took Ties. C.S. disc & nail in new P.P. — E,SE. — 86.15'
C.S. disc & nail in P.P. — N.E. 62.0'
Center of 36" Elm stump — S.E. 47.1
Road regraded This date.

(7) 4-15-11

"741005" SEC COR 9-10-15-16 CASCADE
FOUND PIPE @ SURFACE OF 55TH ST NW IN GOOD CONDITION. TIE OUT OF CORNER FOR CONSTRUCTION SET 1" SS PIPE/CAP AS REF. 58' E OF ℄ 25TH AVE NW & 17½' S ℄ CALVARY FREE CHURCH DRIVEWAY.

N@ REF PIPE
TRT SE PROP PIN HOUSE # 5519 TO "741005"
226° 18' 40" dh02 — 228° 58' 28" dh00
0°06'14" dh00 — 02°46'02" dh04
226°12'26" — 226° 12'26"

TO SE PROP PIN (FOUND T-BAR)
VA 90°02'27" dv00
SLOPE 359.855 — HOR 359.850

TO "741005"
VA 91°26'07" dv00
SLOPE 162.305 — HOR 162.255

NO. 447 NATIONAL PRINTRITE

11-9-99
EPA BTB RF

"741005" SEC COR 9-10-15-16 CASCADE
SURVEY CREW SET PK NAIL AT SURFACE
FROM TIE OUT TAKEN IN APRIL.