1 9-27-72 dug entire area, found nothing. #832504 (1)
10-6-92 set C/M over 3/8" x 4½" rod M&L 2635.52

1/4 Corner 25 - 36 Farm 108-13.
Set by William Forby 5-1857
11-1886 Hunter P416 No 405 & 36 W Leeds, E Raymond.
Corner gone, all evidence of where it stood gone, run N line
Sec 36 set quarry stone M&L 39.98 2638.68 on a
mean from N 1/4 31 108-12 to NW 35 108-13.
and line after N W 36 set. see 26-27-34-35

Co H D 1967 B328 P3. 60D as P I Sta 78+88.63
or west 2629.24 to P.I at 25-26-35-36. measured
also to SE cor 25 Sta 105+95.93 or 2697.3 from N 1/4 36 east.
- RP to PI a 60D Sp D PP ENE 104.08.
Sp D TP ESE 35.67 (over

topo + on SE corner south HDWL of bridge BM - 970.94'
this BM at Sta 80 + 76.0

9-12-92 set nail in line fence south on direct line between C I M's at section corners. R39.98 2638.68 52 77.36 N 4 L.
a quarry stone. - elect meas to nail from NE 36 2646.39
with total mile 52 75.39 making west ½ mile 2629.0
a shortage of only 169' Hunter meas E side NE¼ 2640.66
2638.9 ach.

9-26 dug entire area 8' N of nail to 12' E of nail 6' deep 1.76
found not a pebble. black soil 7 or 8' deep. — carried transit
to hilltop South 1000' + where fences of entire half mile could be
seen South ½ straight with large post in ½ area and when
this line projected north it fell nearly 15' east of fence south
- did not dig in this area as it was way east of any midway
or recorded location RP 600 set 9-12 28.0 S to Center top new to P.
37.75 SW to ½" bolt N W S T P up 5'

#832504 (2)

Card # 2 1/4 25-36 Farmington 108-13

10-4-72 meas "E" from nail on section line 10. east of 2646.39 nail to point in line fences E & W at Center 36 set by computed angle from north. point 1.3' east of Center huge old corner post, leaning north, and .8' east of meas from west tie up - nail on top brace post which is 7.4' N of .00 for meas north.

- set 120 D P.O.T. on hilltop about 1' W of fence wire (rag on fence) at 1066.09 total to point at Center acc 2638.84


- dug again at 1/4 25-36 easterly and northerly, found definite place where limestone had been with many small flakes type pieces like frost had partially shattered stone before it stuck out of road and got torn out

14.7 east 3.3 north of orig line nail. ORIG RPS.

34.85 SWly to nail in top new corner post.
15.0 WSWly to orig line nail 2646.39 from E

10-6-72 set C/M over. 3/8 x 4½" reinf rod and flywheel of small engine centered over small rod. C/M near 6" deep.

1983
24.18 24.10 4' E of S to single punch hole in E end 24" field culv.
47.57 47.48 SW to conc nail in ½" knot N side tele pole
163.05 162.96 SW corner of W end, N bridge headwall.

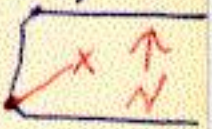

33.1 52.7 11' W of S center top new corner post

This corner tied N & L 2635.52 H 2638.68 betw C/M at NE 36 and nor at NW 36 which fell 5.94 N 4.34 E of C/M at NW 36 - east naturally would bring corner 2.97 N of orig point and 10.87 east. It also would increase lines S to center 36 would come 2637.56 S of corner. or 2638.84 + 2.97 - 2637.56 or 4.25 N of point at (calc) and 2.13 W.

#832504 (3)

1/4 Corner 25-36 Farmington 108-13

40.03 Set a qr sec post in mound of Earth & Sod deposited charcoal made trench & pit planted Osage Orange Seed N & S.

East on Random

42.50 Stream 4 lks wide N.E.

6-15-83, 1/4 for 25-36: Found CIM OK down 6", 6½' South & E-W road and 10'+ East of fence line South.

RP's & Old nail N side telephone pole SW 47.48

Punch hole top E. end field drain culvert SSE 24.10

SW Corner of W. end North bridge headwall ENE 163.14