6-12-1979 CIM

(1)

#450205

section corner. south 2-3 Hi Forest 104-15
6-21-1877 Hunter P319 No 313 S3 J Brewer, J Saulsberry.
found mound with stake remains in center J Rickert.
and impression of one pit. - set new marked stake in place.
- Meas north 40.00

6-23-1877 Hunter P320 - No 314 S2. Samual Saulsberry, Julius Prebe.
found corner described P319.
-16 north. set stake M & L 20.00.
-16 Center SW 1/4 2 set stake M & L 20.00 on E-W 1/16 line.

6-1895 W Fraser P637 No 574 S2 Carl Battcher, A Helmcott.
corner gone. retraced line of Hunter. P319 in setting 1/4 2-3.
after replacing W 1/4 from line east pushed line south of 1/4 2-3 mer)

Meas of 39.66 NW 2 to W 1/4 2 now 39.64 1/2 so made
W 1/2 2 to SW 2 39.98.
- Meas S 1/4 3 to S 1/4 2. which put corner on line from N.
set stake as corner - which came 15 the south & 10 the west
of cor post of fence running east and south.
- Meas west 39.90 - Meas east 39.89.
- 16 north. set stake and boulder. N & L. 19.99.
- 16 center SW 1/4 2. set iron stake by meas
19.96 west to 1/16 - 19.98 north to 1/16.

5-1940 Record slip of 3/4" rod. - County has no record of it
Sp 18" maple S. 35.85 - Sp tele pole NE 68.5.
doubt very much if these RPS are for this corner.

Center SW 1/4 2 1979 Ramon: BK. Page 64 5-22-79
Shot spike 1' So. of the corner post to fence E-W-N. The corner post which is fairly new, and the fence E, both fairly new, all stand 4' to 5' N. of a bulkhead. Dug across bulkhead in line with the fence, went searching for old corner post, but found nothing. Dipped for found iron but didn't find anything. Too much time ordered corner set to cut time in time available.

#450205 (1)

Section Corner South 2-3 High Forest 104-15

1/16th North 1979 Remon. BK Pages 64, 81

Page 64: 5-22-1979 Shot spike in the center of the road and in line with the fence East

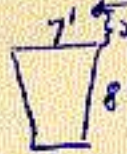
Page 81: 6-6-1979 Dug with backhoe and found a large boulder with pointed top and stake on South side 4½' deep. Removed stake to office and set a ½" rod in the stake hole. Corner 5.35 West and 4.8 South of the t.n. Set 30d spike at road surface.

LRP } T.N. NE 7.2
No:1 NW 9.7

Sec. Corner 1979 Remon BK., Pages 64, 81, 88

Page 64 5-22-79 Set traverse pt., a spike in the center of the road and in line with the fence East

Page 81 6-6-79 Dug with the backhoe from 2' South of the fence East (and t.n) South for 8' an

follows 

to cover Will Fraser measure from the N-S 1/4 line Section 2 and the W1/2 of the E-W 1/4 line Section 2. Found nothing

Page 88 6-12-1979 Dug here again since finding the 1/16th North indicates this corner could be farther South. Found 2" squared up stake appx 20" long 4½' deep. Drove a 1"x36" pipe in the stake hole with a ½"x34" iron in the top of the pipe. Set a piece of stone on the South side of the pipe. Set a CIM @ the road surface over all. The corner is 6½' West & 10' South fence East, and 12½' South fence West and 10.2 South and 5.1 West of the t.n.

RP's: CSD in SE side pp # 24860 SW 76.95
CSD in S. side corner post NW 28.04

#450205 (#3)

HI FOREST SOUTH SECTION CORNER 2-3
Gov't Notes Ball L853
North between sections 10 & 11.
80.00 Set post for corner to sections 2-3-10-11. Made mound with trench and put handfull of small stones in center and plnted osage orange seeds in S.E. corner