~~4-15-1966 set CIM over 1¼ x 20 pipe.~~ (1)
9-25-78 CIM – Corner of Corner
¼ corner 14-23 Orion 105-12 #521404
5-1877 Hunter P313 No 307 S23 A Hazelton
corner gone, N W B T stumps place corner at fences
E-W-N but this brings corner 6 rods south of str. line.
1/16 east & west set stakes 20.00 N & L.
Field Book 5 Pg 9 Sec. 23 (B.T.s at 1/16 West 6" H.O. N 73½° E 15 lks.
8" Brk S 21½° E 75 lks)

4-1903 Armstrong P48B S23 F Halloran & Manette:
set corner 155½ lks north of corner post placing
it N & L 39.98 despite a Mr. Manette.

3-1904 Armstrong P74B S 14-23 F Halloran.
See letter in file of this survey
found corner. stake & stone P48B 155½ lks north cor post
1/16 west set iron bar 1"x½"x30" drove iron ½"x6' at
(over) ¼ cor 14-23.

RP 1/16 west. - 10" Bl Oak N 80°E 20 lks.
16" " " N 13°30'E 20 lks
Mear 39.98 N 1/4 23 to NW 2/3.

1/16 east set iron bar. 1/2" x 1" x 36" 19.96 M & L.
8" W. Oak N 58°10'E 43 lks.


4-1966 J Kerr.
Run south section line sec. 14.
Could not find SE 14 or either 1/16 corner; replaced SE corner.
set C I W M & L. over 1" I.P. x 20" pipe 2631
Capped U S 52 Mon. on west side highway E 69.5
S 4.5
east-west fence.

GOV. NOTES - OCT. 6, 1853
WEST ON TRUE LINE BETWEEN SECTIONS 14 + 23
VAR 10°30'E
39.92 SET QR. SECTION POST RED OAK 15 N 88 E 1694
BR. OAK 12 N 83 1/2 W 734
SET STONE AT CORNER 10 x 10 x 2
79.84 SECTION CORNER

1/4 Corner 14-23 Orion 105-12
#52404

9-22-78 Dug from a point midway and 99' South of line, West for 2', East for 7', and South for 9'. Found a 5"x6" square mark in the soil beneath the plow-like which is a probable post location (See Orion back for location).

9-25-78 Continued digging. Dug

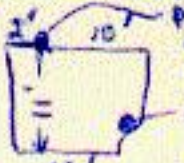

Found a $3\frac{1}{2}$"x 7"/9" x 13" limestone with top broken off down 10" just beneath the plow line and over a black mark dug deep into the subsoil (probable post hole). Set a CIM (down 12") over a 3' piece of telspar and set the stone along side. Corner in cultivated field approx 100' So. of E-W fence and 9' E of line of East side of

house North. Removed Kerr's CIM but left iron beneath it in place.
RP: Spike in N. side most SE'ly 10" Pine in group of pines NW 234.20.

Mn/Dot RP's to ½" re-bar found in N-S twp road near 1/16th E. This is not a 1/16th but will have Mn/Dot Coord. It is 2½' W ℄ and 3' N fr W
cN+D top cor. Fe. po. WSW 26.96
cN+D top fe post SW 47.56

11-4-1983, 1/4 Cor 14-23: Dug up monument for Ron Olson, Surveyor. Corner 351½' West of ℄ T.H. 52 (on curve) and 114' West of most W'ly R/W post on West side of T.H. 52 here

