4-21-80 CIC/p2 #521506 (1)

1/4 corner 15-16 Orion 105-12.

no records —

7-1962 to Hwy Dept — 9-1941 JKerr B 26 P 57

Kerr Meas N & S 2623.0

3/4" steel rod.

+ SW culv wing wall SE 26.64.

+ NW " " " E 22.39

Meas east thru center JKerr ~~5228.64~~ 5245.68


8-1941 CHD B127 P40 set 3/4" steel rod.

2622.4 north of section corner 15-16-21-22.

RPS end of 15" culv north 41.9'

SW corner culv wing wall. North wing E 22.3.

NW corner culv wing wall south wing SE 26.7

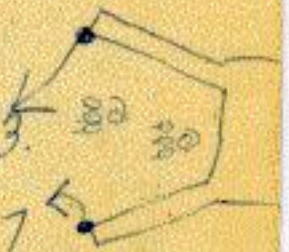

GOV. NOTES - OCT 6, 1853
North between Section 15 + 16
VAR 9° 35' E
40.00 SET 8c. Section Post
No trees near
70.00 DRY Bed of stream 5 lks wide
RUNS EAST

J. Kerr - Field book 85 p. 60-61 - Sec 15 Survey 1902
shows 3/4" rod inplace (probably as recorded in 1941)
Meas. East 2622.8 To Cen. (3/4" pipe) then 2622.8 or
apparently Set M + L on E-W 1/4 line which probably
is incorrect.

4-21-19 Set a CIC/3' long p² - falls about 2.5' east of NW
wingwall corner of Box culvert under CSAH #7
Set this 1/4 corner by midway N & S (2620.64) and
by doubling distance from 1/16th corner (N & S fence) West
and by computed center of section, this location also

1/4 Corner 15-16 Orion 105-12 #521506 (2)

fits the appx ℄ of old C.S.A.H. 7 according to old plans (1940±) which showed the old road appx 20' East of M & L location (got 16')

RP's:

Chisel "x" on N.W. Cor. NW wingwall of Box Culvert West 3.13

Chisel "x" on S.W. Cor. of S.W. Wingwall of Box Culvert SSW 17.56

Cor. post of fence N 4 W West 25.6

℄ CSAH Blacktop East 28.4

4-21-80 1/16th West Set 1/2" rod on South shoulder

of Twp Road on curve.
CSD in pp # 42953 NW 104.85
CSD in pp # 42954 WNW 105.82
Top center of 6" sq. metal Tele. Box South 31.25