#643305

6-16-1964. ~~set CIM over iron~~ & stone party (1)

section corner south 32-33 Roch 106-14.
north 4-5 Ht Forest 105-14

5-1883 Hunter P381 No372 S33 2 Coleman J Hanragan found remains of old post in center mound at corner of fence left as found.
—16 east set stake MbL 19.93 1/2. (1315.71
—16 north " " " 19.93 1/4. (1315.55
—16 center SW 1/4 33 set stone MbL on N-S 1/16 line 19.90 1/2 (1313.73 even with surface.

5-1874 Hunter P252 No 252 S32 JP Dibble.
found corner fence post set in center mound & pits

(over

6-15-64. J Karr E Dody set by DJK 1964 See Karr Bk. 26 p. 36
found iron & stones long used as corner
set C I M over iron stones about corner.
spike in stump 24" burr oak ~~NNW 76.47~~ Gone
fence lines of fence running N & S ~~west 8.0~~
+ south end conc culvert ~~W. 274.15~~ Gone
Disc power pole ~~SW 57.5~~ Changed.
" brace fence post ~~S 38.85~~
corner lies 8' east of fence N & S a little north of road. ±
- meas west to N 1/4 S Co Hwy Dept cor ~~2644.5~~ now 8.36

8-1-72. Zap meas east to C I M over orig boulder
at S 1/4 33. ~~2620.86~~ 2629.22 ~ R 2631.42 P.O.T 1037.85 from Cor E.

Card #2 South 32-33 Rochester 106-14. (2)
North 4-5 High Forest 105-14. #643305

8-2-72 dug entire possible area west of C/M in place and found road had been cut in grading process before road did not wear away but cut away.

8-4-72 found wood stake "well down" as recorded at 1/4 32-33 about 1.5' NE'ly of corner post of fence South and west making mean north to 28-29-32-33 now 2628.1 so removed C/M and moved west 8.36 and north 1.44 so as to place corner exactly double mean and on line as originally used when 1/4 32-33 was set Corner now near line of fence N and S and slightly north of center road where it belongs.

over

Origin ~~Key set~~ original square iron buggy axle and plow shares and numerous small boulders still unknown ↑

Kerr - BK 26, P. 36

Consider corner found and correct.

Meas bow N 2628.1 R 1883 2631

Meas bow E 2629.22 R5-1883 2631.42

52.9 S W to hard nail in org dec on NW side power pole # found 2 numbers a bullet hole back, 83

Mg R P S W 57.5

41.9 S E to root beer bottle cap on NE side Cross base post


265.9 ± W S W ly to punch hole S end new road culv

Meas west to iron placed by Co H D ac S 1/4 32 2636.4

May change will search for Cente 32 and 1/16 corn south later

Section corner South 32-33 Reference 106-14
North 4-5 Witness 105-14
Govt Notes Wm. Kenick, 1854. #643305 (3)
Set post for corner to sections 4-5-32-33
Book 10 S 51 E 33.
Book 12 S 10 W 22.

9-30-81 South 32-33: Dug again after finding the 1/16 East (stone) and 5 1/4 Ln 33 (stone). We were digging centered 6' S and 4' East of the CIM. This area had been cut or was worn out to clay. Diggings here now extend to 8' South of the CIM. We dug today appx 3' off the South side of the old hole and up to 6' East.

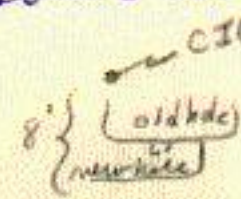

10-13-81 S.32-33: Set a CIM over a ½" x 18" re-rod at double the line and measure from the S¼ Cor 33 (stone Fd) over the 1/16 West (stone Fd.) Corner is 4' South & E-W road and 4½' East of fence line North and South.

RP's: Old C.H.D. Disc in NW side pp #9883 SW 51.16

CSD C side c.p. SSW 34.78

10-14-81 Removed Old CIM and pipe beneath New corner 5.89 South and 3.44 East.

10-2-91 Mike and Ed dug at the 1/16 North.