X 9-1-76 Set 3/4" rod over rod in stake hole #1
12/7/89 C.H.D. SET BRASS PLUG
#731304

1/4 Corner 13-24 Haverhill 107-13.

7-18 74 Hunter P258 No 258 & 24-25 Haverhill
19-30 Viola Johnstevens

Corner gone but found stump NW B T. Mark gone but ~~part of~~ blaze was plain.
Reset 1/4 post from B tree stump.
- Meas east to stone set B Tree 39.82
- Meas west to center N-S road. 39.65.

Mc Ghie 1958

5/8" rod } Should be @ E. Sec. Cor. 13-24

- over -


spike	tele pole	SE	37.07
"	power pole	NE	43.3.
"	top corner fence post	SW	46.63.

T. F. Book 8 p. 2 Sec. 13-107-13 1891 ±
says found iron stake Said To be the Corner as set by T. Hunter, by Mr. Clare? who said he always Knew where Corner was.

1/16 E (8-25-76) Dug 5' [12'] 4' deep to clay on line from Hunter's stone at E 13-24 to CIM at 13-14-23-24 and at midway to calc. location of 1/4 Cor 13-24. Found nothing

1/4 Corner 13-24 Haverhill 107-13 #2 #731304

8-31-76 Dug with backhoe from a pt. 14' W of t.n. W for 9' and S. for 4'. Found road cut into clay at 6½'. Found stake hole with wood pieces extending 12" into clay.

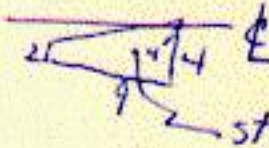

Dug to corner T. H. measure E and W and recorded
Knife 2' S. by T.H. in Old Field Bk #3
Searched for iron stake but did not find it.
Set 5/8" x 18" rod in stake hole which came
approx 17.9' W and 2.3' S t.n.

9-1-76 Set 3/4" x 2' rod at surface. Corner 2' S. of ℄
R.P.s CSO NW side pp # 19396 NE 125.80

CSD N. side of telephone pole SN 117.05
CSD NE side telephone pole SE 50.70

Gov't Notes N.B. 1/Tribl 1853 East Rami 1om
40.00 Std ⊟ temp Std post 13+24
Nails on true line between 13+24
40.00½ Std ⊟ Std post 9°16'E
Bur Oak 7in N 80 W 34 lks
Bur Oak 7in S 72 W 75 lks
8/8/86 SET TRANSIT TIE ¾" PIPE W/ CAP 9½' S. OF ROUND EAR CORN CRIB
⊤Q PIPE ⊀ RT 82°00'00" ¼ COR TO MOST WESTERLY & SHORTEST RADIO TOWER IN SEC 26-107-13 A DISTANCE OF 168.69'
12/7/89 CHD SET ⅝" BRASS PLUG IN E C.R. #2
CHD DISC. IN TOP CENTER COR. POST SSE 62.13'