10-25-1963 set C/M over ½" x 2' rod #933406 Corner in question
at point of old post remains in center road.

¼ corner 33-34 Haverhill 107-13 ①
5-1876 Hunter P292 No 287 L34 J Lawler, J Baier
corner gone but John Clark aware J Daly, J Moriarty
he set corner post of fence in center mound in place
of where original ¼ post stood.
-16 east set stake M & L 19.80 ½ = 1307.13'
-16 center L W¼ 34 set stake M & L 19.88 ¼ on N-S ¼ line
1312.24'

11-1892 2hos Fraser P499 No 470 L33 Frankland Broc.
could not find corner. (likely road now)
set temp point M & L no mark.
-16 north set stake M & L no mark.

-over-

-16 west set temp stake for line north M&L. No mear

1959 Book 79, Page 70

Kerr dug very extensively & carefully found definate remains of old post hole in clean sub-soil in center road 3'S line of fence east - set rod in center hole.

10-1963 set C I M over ½" x 2' rod. | Shot CIM in 1979 control survey

spud in power pole. LW 50.0 49.8

" " tele pole. LE 33.2 gone 7-79

line of fence running east S.A 3.0

10-1972 found C I M. Mear elec S-2629.39.

N-26~~27~~64 2625.57 W 2619.6

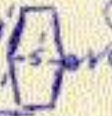
found stone at 27-28-33-34 - stone and iron at Center 33

pipe in B top at S 33-34 - used corner to run line west

this seems to prove corner. Corner lies .85 W of direct line.

#733406 (2)

1/4 Corner 33-34 Haverhill 107-13

7-1-1980 (1980 Remon BK) 1/4 Cr 33-34: Dug on the West side of Kerr's CIM as follows:  There was another road down .8, then another 1½' to clay. Kerr had dug from the monument North for 3½'. We found a square post mark 2.6 North and 4.8 West. Found nothing further. Dug also from 4' East of the CIM East for 9' by 1½' deep to clay. Found a square post mark 9.0 East and 2.0 North of the CIM. Found another post mark 5.8 East and 2.00 North of the CIM (cut spike at rd. surface). This post went deeper into clay than the other two. The main line of the fence East is 2' North of Kerr CIM

post appx 6' East } 6.15 WSW CIM
9.75 NE Nail

post appx 9' East } 9.25 WSW CIM
9.05 N Nail

7-2-80 (1980 Reno BK) 1/16 East: Dug from 14' to 19' West of the traverse nail at c.p. to find N-E-W. Dug from 1' South to 2'+ North of E-W fence. Clay down about 4'. Found nothing. Dug to cover M & L Ken's CIP and not found E to calc N-S 1/4 line Sec 34

7-2-1980 (1980 Reno BK) Center SW 1/4 34: Dug from a point 1.7 West of the traverse nail @ c.p., West for 3' and North 2'. Area came in cattle lane. It was only 1' deep to clay. Found nothing.

#733406 (3)

1/4 Corner 33-34 Haverhill 107-13

7-28-1981 1/4 Cn 33-34: Removed Kerr CIM & Reset CIM at mark found 5.8 East and 2.00 Nott. Set CIM over 1/2" x 24" re-rod. The corner is 4' East of ℄ of N-S road & ±1' So. of fence East & ± 11 North of ℄ Field drive West.

RP's C.S.D. in P.P. SW 55.14

C.S.D. in corner post East 38.78

Aug 1996 Dean Strange of Peoples Coop Found CIM at surface.