#823504 (1)

/

1/4 corner north 1/4 2 Viola 107-12 & Wabasha Co.

10-1889 Chas Fraser P436 No 423 L 2 Titerington, Johnson found stone set by Hunter in unrecorded survey.

— 1/16 west 2 corners here, one set by Hunter and one by another surveyor. (No meas or further comment.

1972- corner very doubtful. road curves north into Wabasha County east of corner and west of corner. straight road between supposed on County line but could be anywhere. No meas in any direction. or desc. of stone or ℄ on line between section corners. Much work and research before corner could be set.

3-1977 Yaggy Assoc. (Don B.) El. Trav. on N. Line of Sec. 2 - Total dist. 5246.02', he will use M & L point at this 1/4 Cor. which fits N-S fences at this 1/4 cor. - Line fell ± 7' N. of ℄ E-W Road, however, road is not on line in this area because of large hills which road goes around both E & W of this area. Apparently nothing set as 1/4 Cor.

7-6-77 Dug with backhoe in deep fill. Dug on M&L point by Yaggy's. Dug 11' deep. Just coming into black dirt. Could not reach bottom well and side walls were falling in hole so abandoned.

Soil Notes Jones 1953

Set 1/4 section post M&L 40 chains 5250 to mile drove chained stake but 11 moved with tractor.

(2)


1/4 Corner N¼ Cor 2 Viola 107-12
#823504

7-11-1980 (1980 Remon. Book) Dug from center of road (which Yaggy's report is 7½' South of line) North for 12', East for 3 to 4 feet and West for 5 to 6' by 12' deep to clay. The was 11' of sand fill over the natural ground. We found only one mark that was a possible corner location. This mark was about 9" diameter and was filled with the sandfill and went into clay. ~~It could have~~ There were no wood pieces to indicate a post was set here. It could have been where the stone had stood or where someone dug down when we attempted to dig for this corner in 1977.

mark } spike S15.0
spike SW16.7

7-16-1980 (1980 Remon. BK) N¼ Cn 2 : Set spike in road over spot found 7-11-1980 from local reference point and took R.P.'s

- CSD in top of end fence post of fence South
  South 44.50
- Corner of westerly concrete headwall of culvert
  East 192.80

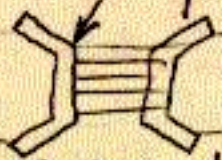

Corner 8' North of center of road.

See Vertical File - Survey Data Range 12 for Yaggy Survey in Section 35, 108-12.

"823504" N 1/4 COR 2 107-12 VIOLA
COULD NOT FIND SPIKE. CSD IN TOP OF
FENCE POST SOUTH STILL HERE. CONCRETE
HEADWALL EAST GONE.

6-28-99
EPA MR AE