/ 8-30-1972 set 1/2" rod by line and meas from south. (1)
#842409

1/4 corner Center 24. Oronoco 108-14.
See also T.H. Book 5 p.96 Sec. 24
5-1877 Hunter P308 no 302 & 24 & 25 Rowley, Webster Stark, & others.
set boulder 10 x 12 x 18 at true intersec lines.
-meas North 39.39 1/2 (~~2598.75~~' or 39.39 1/2 (2600.07'
-16 south. set stake, stone by side N & L 19.86 (1310.76'
-16 west set stake N & L 19.91 1/2. (1314.4'
-16 east set stake N & L 19.93 1/4 (1315.54'
-16 center NE 1/4. 24 set stake N & L 19.81 N-S 1/16 line
-16 center & E 1/4 24 (1307.46'
set stone 7 x 8 x 20 intersec lines.
-16 center & W 1/4 24. set stake intersec lines.

also set 1/16 Cor. North Stone 18"x10"x6"

8-28 to 30-1972. Center 24.
found recorded 1/16 corner South of Com 24
stone. limestone very vertical 3X8X14.
over 6' deep. - set 1/2" rod at surface. large Telephone
Cable. about 2' deep - less than 18" west of 1/16 corner.
- after finding true corner at 1/4 24-25 set by Hunter
5-1877. Meas elec to 1/16 1310.36 R 1310.76
RP 1/16 - south of center 24 north of 1/4 24-25.
4.0'± S to eye line of 1/16 property line fence running E.
7.0'± E to center N-S road.
87.6 NE to cone nail in knot on NW Side PP 33980.
21.15 due W to 16D in bottle cap on top Cor Post of fence W.
- Meas ± east to 1/16 fence corner of fence S & W not N-E.
very near. 1313 corner org set intersections lines.

Card # 2. Center 24 Bronco 10-8-24. (2)

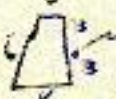
1977 projected exact line north by elec meas to area of Center 24 to 2623.68 a random N-S point #842409 - set 1/2" rod as corner at 2620.72 after digging entire area with back hoe - road slopes quite rapidly from S down to north and turns 90° each (slightly NE'ly) dropping sharply - road worn down to clay and rocky.

36.7 ENE on direct slope ground to bad nail on N side main trunk 24" burr oak with 3 natural blazes on west side - tree crotches up 4' to 2 12" trees.

42.3 SW to NW edge of pledge of Tele cable post with bell.

3.5 N to line of fence running E and W. (over

ran careful traverse, electronic, line north to 1/4 13-24.
a stone recorded as set by 2 settlers in place of orig cor.
before 1877
- set 120 D at P.O.T. by farm entrance (no markers).
4' E of W edge road - eye RP 5 edge elm & NE edge LP gate rock
Coordn - N 2169.25 - W 11.46
- also 120 D at line fence E & W 3' from W. edge road
as near record of 2600.27 as eye could sight in
from nail set in ℄ 2600.18 N, W 17.67

6-1-76 Dug with backhoe 3' deep to bedrock 

. Rock and clay fill. No black dirt. Found nothing. Dug to corr T.H.'s full measure from E.

1/4 Corner Center 24 Oronoco 108-14 (3)
#842409

4-28-1978 Reset this corner by prorating across the E-W 1/4 line of Section 24. We reset the W1/4 24 by doubling line and distance from the 1/16th S. of the W1/4 24. After prorating the total mile the mark we found at the 0 1/16th West was only .04 off E-W direction. Set a CIC/p² at prorated T. Hunter meas. on the E-W 1/4 line section 24. We dug ~~again~~ here previously and found nothing and dug again today for Hunter's stone but the road ditch cut at this point.

R.P.'s: C.S. D4 Spike in 15" blazed oak NW 32.59
Center of corner post W. 25.6
60d in 20" Oak NE 36.77

(over)

Center corner post (leaning) E. 37.5
Corner falls in line of E & W fences and 11 ft W. of the ℄ of the N-S road

1/16th West – Dug and found a dark spot in the clay which is only .04 West and .44 North of the prorated 1/16th we set with a 1/2" x 18" rod midway and on line between the Center 24 and the W1/4 24
RP's: Spike in N side Bur Oak W 11.9
Corner falls 2' North of the E-W fence
Measure East to Cen. 24 = 1312.87

1/16th North – Measured to the location but it fell in the W. ditch of the N-S Twp road

1/4 Corner Center 24 Oronoco 108-14 (4)
#842409

1/16th South - Reset a ½" x 34" rod at the 1/16th South of the Center. Removed the rod that was in place over the stone set by T. Hunter.
RP's: Nail in Knot hole pp# 33980 N.E. 86.64
C.S.D in post (3' S. of cor. post) E 65.55
Corner falls 3' north of the E-W fence and 9' West of the ℄ of the N-S 4up road.

1/16th East. 4-28-78: Set a 5/8"x16" rod at the corrected 1/16 which fell .62 E and .13 South of the small wood piece we found at this corner when we dug (possible stake).
RPs Spike E side 20" Oak SSE 13.7
Base of corner post ENE 3.7