X 8/7/89 CHD SET BRASS PLUG IN C.R. #5 #853106 (1)

Section corner Township corner

SW corner 31 New Haven 108-15E

NW " 6 Kalmar 107-15E

2-1870 Robt Perry P98 No 140 & 6 C Kutzler

NE and SW B Trees standing SE B T stump lately marked

note brought corner on NW corner of holder found.

-16 east set oak "post" at 19.36 (1277.8' rdw.

19.86 to (1310.8' post and stone found making 39.22. 1258.6

orig records call for 19.50 (1287' the 3 20.00 3950/2607

-Robt Perry put shortage 4 mile 28 links (1848' all on west

half as stone & stake found as S ¼ 31 was 2640' from E.

the NE cor 6 being post proved by B Trees which also

was N ¼ 6 proved by B.T. (over

1935 Alm Co Hwy Dept B 88. ~~P 76~~ Plat.
Bk 84 P. 76
→ found stone corner (?) limestone Mon 1½' deep.
fence corner W 21.5 fence corner E 27.9.
tele pole SE 34.5
corner in line E-W fences in center road.
Meas north 1317.0 to center road intersec.
— B 194 P 4 1950 set drag tooth center road section ⅛ N.
RP ⅛ north. Dec in FP NE 51.74 - Dec in TP SE 52.53
Dec Cor FP SW 56.0 - Dec PP NW 52.05
Meas each 5216.0

4-12-71 Co surv. found heavy dip in center road indicating C/M set likely by Perk Hingham.
May dig out to prove corner in future meas E (see S¼ 31.

#853105 (2)

Section Corner

CIM } N 5.46 E 1.17

2x2 Hub } 4.80 N 3.45 E

stone } 9.2 NE 9.0 E


Township Corner

SW Corner 31 New Haven 108-15

NW Corner 6 Kalmar 107-15

11/13/78 Dug on the West side of the CIM (removed) (used as a traverse point) in ℄ N-S road and in line with fences East and West. Found the CIM only 2 sections long and set on nothing. Continued digging West. Found a limestone 8"x8"x24" with irregular shaped boulder-like top down 2½' deep 7.23 West and .50 South of the CIM location. Set a bolt on the West side, a piece of C.I.M. on the N. side, and a ½" iron and a 1" iron on the East side of the stone. Put piece of

blacktop around the stone. We also found a 2"x2" hub (removed) .85 North and 1.55 West of the CIM location. Dug Left spike @ rd surface over stone.

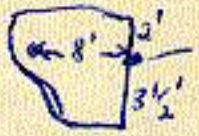

RP's: Disc in pp # 41347 SW 90.28 90.19 7-85
Disc in S. side corner post W 38.81 38.88 7-85
X Mon corner post E 53.37
The corner falls 7' West of ℄ of N-S road and in line of fences E & W.
Spike in N. side 25" Burr Oak E 238.3

~~Gone Yes~~
~~Disc To remarks~~

7-85, SW Cn 31: CHD set a 2x2 hub with tack 89.06 East of the corner and on line to a plastic disc in large oak in fence line running east.

SW Corner 31, New Haven 108-15 (3)
NW Corner 6, Kalmar 107-15 #853105

7-15-85, SW 31: Took additional references before road construction. Drove 1" sq pipe/cap under fence running West
π @ 1" sq pipe – meas. to SW 31 = 106.97
+ Rt spike & dia in oak tree east of SW31 to SW 31 = 0°55'00"
8/7/89 C.H.D. SET 5/8" BRASS PLUG IN ℄ C.R.
#5 Rp's
CSD IN P.P. SW 99.04'