#733006 (1)

8-1962. set CIM in place of pipe at corner.
4-22-1975 - reset CIM in place of broken CIM - dug a while accepted Kirk's corner

1/4 Corner West 1/4 30 Haverhill 10 7-13

East 1/4 25 Cascade 10 7-14

6-18 76 Hunter P300 No 295 L25 R Smith
H Messenger
found mound & pits plain with pole in middle mound
16- west found part of stake set 9-1858 P56 nailed to
corner post M & L. 19.67 in 1859. = 1876 - 19.75

9-1891 Thos Fraser P456 No 440 L30 John Hole.
found stone set by Hunter at city limits edge.

12-3-1900 T Fraser P100 No 616 L30 and W 1/2 25
found stone broken off 1 1/2' below ground. replaced piece & set
stake by side of new complete stone

- over -

-Near North 39.73. which is midway N-S 1/4 corners
-16 West found corner past P 300 just south of line
set stone on north side of corner past M & L 19.74
-16 south set stake M & L 19.76 1/4 = 1304.33 x 2 = 2608.65

Corner found - pipe placed as corner. 1 1/2' West of F Cor.
J Kerr set C I M in place of pipe
now Northeast corner Wilshire Heights., fate unknown.

Kerr Book 46 p.64 Says Kerr reset Corner -
1/2" steel pipe underneath pointed L.S. 1950

4-22-75 — dug 4' dia. hole - fd flat L.S. standing Vert. 1' N. & 1' East of Mon. - did not use - reset C I M. on 3/4" pipe
47.4'


NW Corner House SW 62.83'. Top Center Hydrant S 107.80'
SE Corner of Chimney (5' W of S) 97.95'. gone

1/4 Corner West 1/4 30 Haverhill 107-13 (2)
East 1/4 25 Cascade 107-14 #733006

July, 1859 T. Hunter Pg. 62 No. 88 shows 1/4 Post.
1/16 South 19.82 chs. mdL to Sec. Cor.
(see survey for breakdown of S.E 1/4 Sec 25 107-14).

[illegible]

11-19-84, W 1/4 Cor 30: Found pipe/cap #10162 leaning East but top fit 1975 tie to NW. Cor. House and SE corner of chimney very close. Pipe at Westerly edge concrete slab of electrical box. Removed pipe and found CIM tipped way East
Dug down to pipe beneath

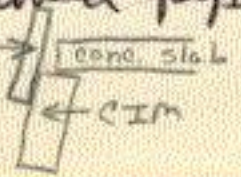

20" CIM. Set a 16" CIM over pipe and p/pcf/cap #10162 on center of CIM. Pipe came in same location as top of leaning pipe. Corner in NE Cor for House # 1611, 19th St NE.

RP's NW Cor House SW 62.82
SE Cor Chimney SSW 47.97

Sept. 27 1858 Thomas Hunter (P56 No. 82) used ¼ post measured north 39.72 chs., west 19.67chs then 19.67chs, to center of 25